

Release Notes for DrayTek Vigor2830n V2 (UK/Ireland)

Firmware Version	3.8.5
Release Type	Regular – Upgrade recommended when convenient
Release Date	24 th October 2017
Build Date	24 th October 2017
Revision	69451
Applicable Models	Vigor2830n 'v2'
ADSL Modem Code	571801_A (Standard), 571701_A
Locale	UK Only / Annex A Only

New Features

(None)

Improvements

1. Improvements to Wireless WAN (WAN2) mode WPA2 security to protect against WPA2 Key Reinstallation Attack (KRACK), for more details please read this security advisory: <https://www.draytek.co.uk/information/our-technology/wpa2-krack-vulnerability>
2. Resolved an issue with NAT loopback when forwarding to WAN IP Alias addresses

Known Issues

1. Configuration settings in 3.8.5 firmware are not backwards compatible with 3.7.8.1. It is not possible to downgrade from 3.8.x to 3.7.8.1 and retain settings. To downgrade, use the .rst file to clear settings.

Before upgrade to 3.8.5 we recommend taking a backup of the previous configuration. To downgrade to 3.7.8.1 onto a unit running 3.8.5, first .rst reflash 3.7.8.1 and then restore a previously saved .cfg from 3.7.8.1 or earlier.

IMPORTANT NOTE – Hardware Versions

This firmware can only be used if your unit is a 'v2' (version 2). This firmware is not for use with the version 1 model. If you're not sure which you have, check this guide:

<http://www.draytek.co.uk/support/guides/kb-v2830n-v1-vs-v2>

Firmware File Types

The ZIP file contains the firmware with two different file extensions, .ALL and .RST. The firmware is identical but the RST file contains factory default settings. If you install the ALL file, your router will retain all existing settings. If you use the RST file, all settings will be wiped from your router.

Upgrade Instructions

It is recommended that you take a configuration backup prior to upgrading the firmware. This can be done from the router's system maintenance menu.

To upgrade firmware, select '*firmware upgrade*' from the router's system maintenance menu and select the correct file. Ensure that you select the ALL file unless you want to wipe out your router's settings back to factory default.



Manual Upgrade

If you cannot access the router's menu, you can put the router into 'TFTP' mode by holding the RESET whilst turning the unit on and then use the Firmware Utility. That will enable TFTP mode. TFTP mode is indicated by all LEDs flashing. This mode will also be automatically enabled by the router if there is a firmware/settings abnormality. Upgrading from the web interface is easier and recommended – this manual mode is only needed if the web interface is inaccessible.

Firmware Version	3.8.1.2
Release Type	Regular – Upgrade recommended when convenient Note: A previous firmware (3.8.1.1) was a critical release . This f/w includes all changes/improvements that were in 3.8.1.1.
Release Date	4 th August 2017
Build Date	3 rd July 2017
Revision	66612
Applicable Models	Vigor2830n 'v2'
ADSL Modem Code	571801_A (Standard), 571701_A
Locale	UK Only / Annex A Only

New Features

1. Support for extra TR-069 parameters
2. Support WAN load balance by Session, configured in [WAN] > [General Setup]

Improvements

1. Improved Content Filtering of Youtube when accessed through the Google Chrome browser
2. [VPN and Remote Access] > [PPP General Setup] Dial-In PPP Authentication can now specify "MS-CHAPv2 Only"
3. Resolved an issue with NAT loopback when forwarding to WAN IP Alias addresses

Known Issues

1. Configuration settings in 3.8.1.2 firmware are not backwards compatible with 3.7.8.1. It is not possible to downgrade from 3.8.x to 3.7.8.1 and retain settings. To downgrade, use the .rst file to clear settings.
Before upgrade to 3.8.1.2 we recommend taking a backup of the previous configuration. To downgrade to 3.7.8.1 onto a unit running 3.8.1.2, first .rst reflash 3.7.8.1 and then restore a previously saved .cfg from 3.7.8.1 or earlier.

Firmware Version	3.8.1.1
Release Type	Critical – Upgrade recommended immediately
Release Date	20 th December 2016
Build Date	8 th December 2016
Applicable Models	Vigor2830n 'v2'
ADSL Modem Code	571801_A (Standard), 571701_A
Locale	UK Only / Annex A Only

New Features in this Firmware

(None)

Improvements in this firmware

1. Security improvements including one or more considered critical.
2. Misc. minor WUI changes/corrections.

Known Issues

1. Configuration settings in 3.8.1.1 firmware are not backwards compatible with 3.7.8.1. It is not possible to downgrade from 3.8.x to 3.7.8.1 and retain settings. To downgrade, use the .rst file to clear settings.
Before upgrade to 3.8.1.1 we recommend taking a backup of the previous configuration. To downgrade 3.7.8.1 onto a unit running 3.8.1 first .rst reflash 3.7.8.1 and then restore a previously saved .cfg from 3.7.8.1 or earlier.

Firmware Version	3.8.1
Release Type	Regular – Upgrade recommended when convenient
Release Date	20th May 2016
Build Date	11th April 2016
Applicable Models	Vigor2830n 'v2'
ADSL Modem Code	571801_A (Standard), 571701_A
Locale	UK Only / Annex A Only

New Features

1. WAN2 can now operate in 2.4GHz Wireless Station Mode, switchable with Ethernet mode [WAN] > [General Setup] > [WAN2]
2. WAN1 PPPoE/PPPoA now supports Fallback account, used if the primary details are unable to establish a working connection
3. WAN Connection Detection - Ping Detect now supports Primary/Secondary Ping IP, Interval & Retry parameters
4. Multi-WAN & Multi-LAN IPv6 now supported
5. Notification Objects now have WAN Budget and Central VPN Management options
6. URL Content Filter Profiles now have Exception List option
7. LAN DNS entries now support CNAME (Domain Alias)
8. [Load Balance / Route Policy] > [Diagnose] added
9. DrayTek SMB protocol stack
10. Web Server and SSL VPN supports TLS 1.2
11. VigorACS can now display the status of LAN ports on the router
12. [SSL VPN] > [General Setup] can select which WAN interfaces listen for SSL VPN connections
13. [System Maintenance] > [Firmware Upgrade] can now check for latest available firmware
14. Support for X.509 Certificates over 2048 bytes in size e.g. StartCom
15. SSH now supports 2048-bit DH
16. [Web Portal] feature improvements, now supports HTTPS redirection
17. RTS Threshold and Fragment Length can be configured from [Wireless LAN] > [Advanced Setting]
18. URL Content Filter Profiles now have Exception List option
19. Dynamic DNS configuration now supports up to 64 characters for Login Name and Password settings
20. Telnet command 'adsl snr' allows control of SNR target

Improvements

1. Changed TCP Initial sequence number mechanism
2. Added X-Frame-Options to HTTP headers
3. Session validation method improved in Web UI
4. Improved TCP SYN protection mechanism
5. TCP port 2869 and UDP port 1900 responding on WAN when UPnP enabled
6. Improved LDAP compatibility with Windows Server OS
7. DNS Queries could be blocked by the router's firewall in some situations
8. [LAN] > [Bind IP to MAC] ARP table could not display IP address over 11 digits
9. Added DHCP setting for "Next Server IP Address"

Known Issues

1. Configuration settings in 3.8.1 firmware are not backwards compatible with 3.7.8.1. It is not possible to downgrade from 3.8.x to 3.7.8.1 and retain settings. To downgrade, use the .rst file to clear settings.
Before upgrade to 3.8.1 we recommend taking a backup of the previous configuration. To downgrade 3.7.8.1 onto a unit running 3.8.1 first .rst reflash 3.7.8.1 and then restore a previously saved .cfg from 3.7.8.1 or earlier.

Firmware Version	3.7.8.1
Release Date	6th July 2015
Build Date	15th June 2015
Applicable Models	Vigor2830n 'v2'
ADSL Modem Code	544401_A (Standard), 552011_A
Locale	UK Only / Annex A Only

New Features

1. The router's Online Status can display DSL information from a Vigor 130 modem connected to WAN2.
2. Support for TR-069 HTTP/HTTPS trigger, available in [System Maintenance] > [TR-069] "Test with Inform" button.

Improvements

1. Resolved an issue with the Firewall that could stop users accessing the internet due to a session limit error under some circumstances.
2. Added additional TCP SYN protection from WAN.
3. Web interface improved to protect against Cross-Site-Request-Forgery attacks.
4. RFC-1483 Routed IP LLC mode did not work correctly.

Firmware Version	3.7.8
Release Date	16th February 2015
Build Date	8th February 2015
Applicable Models	Vigor2830n 'v2'
ADSL Modem Code	544401_A (Standard), 552011_A
Locale	UK Only / Annex A Only

New Features

1. Added the DNS filter object in [Firewall] > [General Setup] which allows the DNS filter to be applied using filter rules. DNS filter can now use either URL or WCF filter profiles.
2. Supports Virtual IP Mapping for LAN to LAN VPN tunnels, to map / NAT local IPs to a required subnet.
3. [Load Balance/Route Policy] now supports metrics.
<http://www.draytek.co.uk/support/guides/kb-policy-routing-guide-v2>

Improvements

1. Improvements to the layout of the [System Maintenance] > [SNMP] page.
2. The router's TCP SYN attack protection has been improved.
3. [Applications] > [LAN DNS/DNS Forwarding] now supports DNS forwarding, to forward specific DNS requests to other DNS servers.

Firmware Version	3.7.4.2
Release Date	12th December 2014
Build Date	4th December 2014
Applicable Models	Vigor2830n 'v2'
ADSL Modem Code	544401_A (Standard), 552011_A
Locale	UK Only / Annex A Only

New Features

(None)

Improvements

1. SSL3 now disabled in favour of TLS by default for SSL tunnels and web management.
2. Improved display of IPv6 static routes with a prefix length of /128 in [Diagnostics] > [Routing Table].
3. Improvements to wireless performance with multiple wireless clients.

Firmware Version	3.7.4.1
Release Date	24th September 2014
Build Date	22nd September 2014
Applicable Models	Vigor2830n V2
ADSL Modem Code	544401_A (Standard), 552011_A
Locale	UK Only / Annex A Only

New Features

(None)

Improvements

1. LAN users were prevented from accessing router's Web UI using HTTPS via WAN IP.
2. Connection mode for WAN2 wasn't shown correctly in VigorACS SI.
3. LAN2 Routing Mode didn't respond to WAN ARP requests from LAN Clients like IP Routed Subnet did.
4. Stability of WCF mechanism improved
5. Fixed a problem of memory usage after PPPoE disconnection.
6. Mail Alert did not work with 1and1 SMTP server.
7. New TR069 parameters added to cater for VigorACS SI 1.1.5
8. Could not show "_" character in the comment field of Bind IP to MAC.

Firmware Version	3.7.4
Release Date	1st July 2014
Applicable Models	Vigor2830n V2
ADSL Modem Code	544401_A (Standard), 552011_A
Locale	UK Only / Annex A Only

First Firmware Release for this model

[END OF FILE]