Release Notes for DrayTek Vigor 2960 (UK/Ireland)

Firmware Version	1.4.0 (Formal Release)	
Release Type	Regular – Upgrade recommended when convenient	
Build Date	28 th April 2018	
Release Date	17 th May 2018	
Revision	7702	
Applicable Models	Vigor 2960	
Locale	UK & Ireland Only	

New Features

- 1. OpenVPN support added as a VPN protocol for Remote Dial-In Users
- 2. DrayDDNS (DrayTek Dynamic DNS) support added in [Applications] > [Dynamic DNS]
- Support for Let's Encrypt HTTPS certificates added in:
 [Certificate Management] > [Local Certificate] (click Let's Encrypt button to configure)
- 4. Support for Remote Dial-In user IKEv2 connections using Windows 7, 8, 10 VPN client
- Inter-LAN Routing configuration now supports Route Groups to give detailed control of connectivity between VLANs

- 1. Support for VigorACS Server version 2.3.0
- 2. Configuring a backup WAN interface in [Routing]>[Load Balance Pool] now allows the backup interface to operate as a backup for multiple WAN interfaces, instead of a single WAN
- 3. Setting the Load Balance Mode to Session-Based now allows selection of protocols to exclude from the Session-Based Load Balance mechanism i.e. HTTPS & IPsec
- 4. Added "Exclude LAN-to-WAN Traffic from DoS Defense" option to ignore outbound traffic from DoS defense in [Firewall]>[DoS Defense]>[System]
- 5. Support source NAT for incoming traffic in [NAT]>[Port Redirection] with the Change Source IP setting, which translates the external IP into the specified internal source IP
- 6. Improved handling efficiency of IPsec ISAKMP packets
- 7. Improvements to VPN handling to increase VPN upload & download throughput
- 8. IKEv2 IPsec VPN now supports FQDN as a Local / Remote ID type
- 9. Remote Dial-In User IKEv2 VPN now supports LDAP / RADIUS authentication
- 10. Improved IKEv2 VPN tunnel interoperability with Fortinet VPN endpoints
- 11. IKEv2 LAN to LAN VPN tunnels can specify these new Proposal options:
 - a) Diffie-Hellman (DH) Group 19 (256-bit Elliptic Curve)
 - b) Diffie-Hellman (DH) Group 20 (384-bit Elliptic Curve)
 - c) Diffie-Hellman (DH) Group 21 (512-bit Elliptic Curve)
- 12. Improved display of VPN uptime in [VPN and Remote Access] > [Connection Management]
- 13. Added note to [VPN and Remote Access] > [PPP General Setup] with recommended VPN types for each client platform
- 14. Allowed IPsec Dial-In Security methods (DES, 3DES, AES) can now be specified for IPsec Remote Dial-In Users from [VPN and Remote Access] > [IPsec General Setup]

- 15. Changing LAN configuration settings (except for the router's LAN IP) no longer drops active Internet / VPN connections
- 16. Improved wording in [VPN and Remote Access] > [PPP General Setup] > L2TP tab
- 17. Updated OpenSSL for CVE-2018-0739
- 18. Reduced the time from router restart / power up to activate the router's LAN and WAN interfaces
- 19. Added an import/export button for keyword objects
- 20. Updated APP Enforcement signatures
- 21. Update the Cyren URL Category Check Link
- 22. Added "More log" (more detailed syslogs) option in [Firewall]>[Filter Setup]>[URL/WCF Category Filter] profiles
- 23. DrayTek WCF and URL filter log can be displayed on [System Maintenance]>[Syslog/Mail Alert]>[Syslog File]
- 24. Support default route and failover function for BGP
- 25. Added auto configuration backup option in [System Maintenance]>[Configuration Backup]
- 26. The warning message for changing access port number will be shown only when remote access is enabled
- 27. Add an option (for user/guest profile) to log out online device when login number over the limit
- 28. Support router's local services (NTP, DNS and so on) via WAN alias IP
- 29. Improved the interface to add WAN IP Alias entries in [WAN]>[General Setup]
- 30. Vigor router can intercept the DNS packets to reply or forward the DNS query according to LAN DNS setting
- 31. Add an option of "Enable / Disable SMBv1" in [USB Application]>[SAMBA Server]>[General Setup]
- 32. Improved the menu layout for AP Management
- 33. DoS options can no longer be modified when the DoS Defense Enable option is not ticked
- 34. Support destination IP selections for white list settings on [User Management]>[Web Portal]>[General Setup]
- 35. Use System Time instead of Browser Time to display Traffic Graph
- 36. CSM: Unable to open Yahoo WEB page after applying URL keyword "flickr" for web page blocking
- 37. GRE tunnel was not displayed in the connection management after the profile was renamed
- 38. Renaming the IPsec profile in [VPN and Remote Access]>[VPN Profile]>[IPsec] resulted in empty MultipleSA settings for that profile
- 39. IPsec VPN tunnels connecting in NAT mode to WAN Alias IP could not pass traffic correctly
- 40. Use Alias IP was incorrectly displayed on policy route web page when USB WAN interface was selected
- 41. SNMP Trap packets could not be sent through WAN Alias IP
- 42. IPsec VPN was up but no traffic passed through after some time (VPN routes disappeared)
- 43. When authenticating SSL VPN with MSCHAPv2, authentication could be delayed by 30s
- 44. Unable to add more than one VPN remote subnet via CLI command "more_remotesubnet"
- 45. Improved connectivity for LAN clients connecting to Remote Dial-In Users connected via VPN
- 46. Traffic was unable to pass through IPsec multi-SA tunnel
- 47. Vigor router did not validate End IP in IP Object range

- 48. Unable to register to VigorACS 2 successfully in some situations
- 49. AP management mechanism did not send the provision packet to VigorAP in some scenarios
- 50. Static route via LAN PPPoE client did not work (LAN client works)
- 51. Disabling a PPPoE user profile still allowed a user to make PPPoE connection with that profile
- 52. System time displayed on mobile web interface was 2hrs off from desktop web interface
- 53. LDAP Search function is no longer available in Simple mode
- 54. Improved resilience of the router's Mail service
- 55. When WAN Inbound Load Balance was on, Vigor router would do DNS query from WAN for other domains outside the configured IP
- 56. Vigor router could not generate correct amount of user access logs in some conditions i.e. 1000 connections established in 5 seconds
- 57. Could not use 'space' in defining name of certificate
- 58. Accessing Vigor router from WAN2 was allowed even only set the Internet Access Control to WAN1 on [System Maintenance]>[Access Control]
- 59. End user got 2 email alerts when WAN was down
- 60. Ping connection detection did not disconnect USB WAN
- 61. Display error for TTL on [Diagnostics]>[Session Table]>[NAT]
- 62. DDNS user-defined profile could not upload the IP to the server properly when using HTTPS
- 63. URL/Web filter couldn't block HTTPS website if HTTPS was accepted in an IP filter profile with "if no further match"
- 64. Firewall Syslog could not be disabled when the rule action was "Block If No Further Match"
- 65. Syslog could send some unnecessary information for RADIUS authenticated connections
- 66. Additional TR-069 parameters added for these menus & settings:
 - a) [VPN and Remote Access]
 - b) Local ID/Remote ID of [VPN and Remote Access]>[VPN Profiles]>[Basic]
 - c) [NAT]
 - d) [Routing] and [LAN/WAN VLAN]
 - e) [DNS Security]
 - f) [GVRP]
 - g) [IGMP Proxy]
 - h) [High Availability]
 - i) [Wake on LAN]
 - j) [SMS/Mail alert service]
 - k) Local / Remote address of [Bandwidth Management]
 - I) [Profile Number Limit]

Known Issue

- Central VPN Management If Central VPN Management is configured and used to manage other DrayTek routers, keep using F/W 1.3.3.2 and wait for the next firmware release.
 Routers cannot be managed / monitored through Central VPN Management with F/W 1.4.0.
- Central AP Management If Central AP Management is configured and used to manage VigorAP access points, keep using F/W 1.3.3.2 and wait for the next firmware release.
 VigorAPs cannot be managed / monitored through Central AP Management with F/W 1.4.0.

- 3. **High Availability** Updating from a firmware version <=1.1.0.2: Due to significant changes to High Availability functionality, existing HA configuration will be cleared during the update process and it will be necessary to reconfigure High Availability after the update
- 4. **L2TP Tunnel** Disable "Force IPsec with L2TP" option in [VPN and Remote Access] > [PPP General Setup] to allow a standard L2TP tunnel, otherwise the L2TP server will allow L2TP with IPsec only
- 5. **IP Filter** F/W 1.2.0 onwards changes the behaviour of the IP Filter. After upgrade some IP Filter rules may need to be reconfigured. Please read the "Filter Rule Actions" segment of this guide for more information on the changes:
 - http://www.draytek.co.uk/support/guides/kb-3900-ipfilter-basics
- 6. Vigor2960 models with MXIC flash memory cannot be downgraded to firmware prior to 1.2.0.

Check the flash memory type with the CLI command "status system":

Model: Vigor2960

Hardware Version: 1.0 (M) <---- (M) suffix indicates MXIC Flash memory

Hardware Version: 1.0 <----- no suffix indicates Samsung Flash memory, can be

downgraded if required

Important Note - Upgrading Firmware

Do not upgrade directly from 1.0.5 (and earlier) to 1.3.3.2.

Due to differences in the Web UI and functionality the router MUST first be upgraded to at least 1.0.7.1 prior to upgrading to 1.3.3.2.

Upgrade your router to Version 1.0.7.1 or later first, and afterwards upgrade the router to Version 1.3.3.2.

Upgrade Instructions

It is recommended that you take a configuration backup prior to upgrading the firmware. This can be done from the router's system maintenance menu.

To upgrade firmware, select 'firmware upgrade' from the router's system maintenance menu and select the correct file.



Manual Upgrade

If you cannot access the router's menu, you can put the router into 'TFTP' mode by holding the RESET whilst turning the unit on and then use the Firmware Utility. That will enable TFTP mode. TFTP mode is indicated by all LEDs flashing. This mode will also be automatically enabled by the router if there is a firmware/settings abnormality. Upgrading from the web interface is easier and recommended – this manual mode is only needed if the web interface is inaccessible.

Firmware Version	1.3.3.2 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Build Date	10 th April 2018
Release Date	1 st May 2018
Revision	7677
Applicable Models	Vigor 2960
Locale	UK & Ireland Only

(None)

Improvements

1. When using the Web Portal to control Internet access, Guest accounts could not log in to the Web Portal for Internet access

Known Issue

- 1. **High Availability** Updating from a firmware version <=1.1.0.2: Due to significant changes to High Availability functionality, existing HA configuration will be cleared during the update process and it will be necessary to reconfigure High Availability after the update
- L2TP Tunnel Disable "Force IPsec with L2TP" option in [VPN and Remote Access] > [PPP
 General Setup] to allow a standard L2TP tunnel, otherwise the L2TP server will allow L2TP
 with IPsec only
- 3. **IP Filter** F/W 1.2.0 onwards changes the behaviour of the IP Filter. After upgrade some IP Filter rules may need to be reconfigured. Please read the "Filter Rule Actions" segment of this guide for more information on the changes: http://www.draytek.co.uk/support/guides/kb-3900-ipfilter-basics
- 4. Vigor2960 models with MXIC flash memory cannot be downgraded to firmware prior to 1.2.0.

Check the flash memory type with the CLI command "status system":

Model: Vigor2960

Hardware Version: 1.0 (M) <---- (M) suffix indicates MXIC Flash memory

Hardware Version: 1.0 <----- no suffix indicates Samsung Flash memory, can be

Firmware Version	1.3.3.1 (Formal Release)	
Release Type	Critical – Upgrade recommended immediately	
Build Date	27 th March 2018	
Release Date	4 th April 2018	
Revision	7657	
Applicable Models	Vigor 2960	
Locale	UK & Ireland Only	

(None)

Improvements

- 1. Improvement related to firmware security
- 2. Resolved IPsec stability issue that was present in 1.3.3 firmware
- 3. Remote Dial-In user accounts created in 1.3.3 firmware could not establish a VPN tunnel after restarting the router

Known Issue

- 1. **High Availability** Updating from a firmware version <=1.1.0.2: Due to significant changes to High Availability functionality, existing HA configuration will be cleared during the update process and it will be necessary to reconfigure High Availability after the update
- L2TP Tunnel Disable "Force IPsec with L2TP" option in [VPN and Remote Access] > [PPP
 General Setup] to allow a standard L2TP tunnel, otherwise the L2TP server will allow L2TP
 with IPsec only
- 3. **IP Filter** F/W 1.2.0 onwards changes the behaviour of the IP Filter. After upgrade some IP Filter rules may need to be reconfigured. Please read the "Filter Rule Actions" segment of this guide for more information on the changes: http://www.draytek.co.uk/support/guides/kb-3900-ipfilter-basics
- 4. Vigor2960 models with MXIC flash memory cannot be downgraded to firmware prior to

Check the flash memory type with the CLI command "status system":

Model: Vigor2960

Hardware Version: 1.0 (M) <---- (M) suffix indicates MXIC Flash memory

Hardware Version: 1.0 <----- no suffix indicates Samsung Flash memory, can be

Firmware Version	1.3.3 (Formal Release)	
Release Type	Critical – Upgrade recommended immediately	
Build Date	22 nd March 2018	
Release Date	22 nd March 2018	
Revision	7640	
Applicable Models	Vigor 2960	
Locale	UK & Ireland Only	

(None)

Improvements

1. Improvement related to firmware security

Known Issue

- 1. **High Availability** Updating from a firmware version <=1.1.0.2: Due to significant changes to High Availability functionality, existing HA configuration will be cleared during the update process and it will be necessary to reconfigure High Availability after the update
- L2TP Tunnel Disable "Force IPsec with L2TP" option in [VPN and Remote Access] > [PPP
 General Setup] to allow a standard L2TP tunnel, otherwise the L2TP server will allow L2TP
 with IPsec only
- 3. **IP Filter** F/W 1.2.0 onwards changes the behaviour of the IP Filter. After upgrade some IP Filter rules may need to be reconfigured. Please read the "Filter Rule Actions" segment of this guide for more information on the changes: http://www.draytek.co.uk/support/guides/kb-3900-ipfilter-basics
- 4. Vigor2960 models with MXIC flash memory cannot be downgraded to firmware prior to 1.2.0.

Check the flash memory type with the CLI command "status system":

Model: Vigor2960

Hardware Version: 1.0 (M) <---- (M) suffix indicates MXIC Flash memory

Hardware Version: 1.0 <----- no suffix indicates Samsung Flash memory, can be

Firmware Version	1.3.2.1 (Formal Release)	
Release Type	Regular – Upgrade recommended when convenient	
Build Date	12 th December 2017	
Release Date	10 th January 2018	
Revision	7468	
Applicable Models	Vigor 2960	
Locale	UK & Ireland Only	

(None)

Improvements

1. Central AP Management could not display the status information of VigorAP access points managed by Central AP Management using HTTPS protocol

Known Issue

- High Availability Updating from a firmware version <=1.1.0.2: Due to significant changes to High Availability functionality, existing HA configuration will be cleared during the update process and it will be necessary to reconfigure High Availability after the update
- L2TP Tunnel Disable "Force IPsec with L2TP" option in [VPN and Remote Access] > [PPP General Setup] to allow a standard L2TP tunnel, otherwise the L2TP server will allow L2TP with IPsec only
- 3. **IP Filter** F/W 1.2.0 onwards Changes the behaviour of the IP Filter. After upgrade some IP Filter rules may need to be reconfigured. Please read the "Filter Rule Actions" segment of this guide for more information on the changes: http://www.draytek.co.uk/support/guides/kb-3900-ipfilter-basics
- 4. Vigor2960 models with MXIC flash memory cannot be downgraded to firmware prior to 1.2.0.

Check the flash memory type with the CLI command "status system":

Model: Vigor2960

Hardware Version: 1.0 (M) <---- (M) suffix indicates MXIC Flash memory

Hardware Version: 1.0 <----- no suffix indicates Samsung Flash memory, can be

Firmware Version	1.3.2 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Build Date	28 th October 2017
Release Date	23 rd November 2017
Revision	7373
Applicable Models	Vigor 2960
Locale	UK & Ireland Only

 Fast NAT functionality added to improve outbound NAT throughput by bypassing firewall processing for specified local subnet(s) going through selected WAN interfaces.
 Configured in [NAT] > [Fast NAT]

- 1. Updated DNSMasq to improve security, for more details please read this security advisory: https://www.draytek.co.uk/information/our-technology/dnsmasq-vulnerability
- 2. Firmware Boot loader updated to 1.3.2
- 3. Configured and functioning URL/Web Category Profiles could display as a blank profile in the web interface
- 4. Syslog output would report the rate unit as Kbps when setting the Filtering Rate (Mbps) in [Firewall] > [DoS Defense] > [Switch Rate Limit] > [Storm Filter]
- 5. Access Barrier for HTTPS management could potentially block an authenticated HTTPS management session
- 6. Corrected a potential error which might result in flooding a WAN interface removed from the Load Balance Pool
- 7. The Counter value for URL/Web Category Filter rules could not increment when blocking HTTPS websites
- 8. LDAP with Bind Type set to "Regular Mode" When clicking the Search button for Base DN, the router would attempt to bind with Root, which caused compatibility issues with Windows LDAP servers
- 9. HTTPS filtering behaviour was incorrect when filtering with a keyword of "."
- 10. Improved reliability of filtering by File Extension with the Firewall
- 11. High Availability failover did not occur when all WANs failed on the primary router
- 12. Multiple subnets available through a VPN Trunk in Backup mode were unavailable when Primary Interface VPN tunnel dropped and the Backup Interface VPN tunnel became active
- 13. VPN tunnels were unable to route traffic if a PPPoE WAN was disconnected, remained offline for over 12 hours and was then reconnected
- 14. Dial Out IPsec VPN could not establish if VPN server hostname started with a number (0-9)
- 15. After upgrade from firmware 1.2.2, [VPN and Remote Access] > [Connection Management] could not display profile names for IPsec VPN tunnels, displaying a "Lack of Ptype" error
- 16. Web Portal could conflict with IP filter rules
- 17. Improved [Bandwidth Management] > [Bandwidth Limit] rate limiting algorithm
- 18. AP Management broadcast packets no longer send through VPN tunnels, this can be enabled in [AP Management] > [General Setup] by enabling "Pass-Through VPN"
- 19. Improved Web Portal login page load times
- 20. QoS profiles and Firewall Filter Rules can now specify up to 200 Service Type Objects
- 21. IPsec VPN stability improvements

Known Issue

- APM Management VigorAPs with firmware 1.2.3 and later cannot be managed with AP Management using HTTPS. This will be resolved in the next firmware release.
 Management is still possible using HTTP (less secure) by disabling the HTTPS Allow setting and enabling the HTTP Allow setting in [AP Management] > [General Setup]
- 2. **High Availability** Updating from a firmware version <=1.1.0.2: Due to significant changes to High Availability functionality, existing HA configuration will be cleared during the update process and it will be necessary to reconfigure High Availability after the update
- L2TP Tunnel Disable "Force IPsec with L2TP" option in [VPN and Remote Access] > [PPP
 General Setup] to allow a standard L2TP tunnel, otherwise the L2TP server will allow
 L2TP with IPsec only
- 4. **IP Filter** F/W 1.2.0 onwards Changes the behaviour of the IP Filter. After upgrade some IP Filter rules may need to be reconfigured. Please read the "Filter Rule Actions" segment of this guide for more information on the changes: http://www.draytek.co.uk/support/guides/kb-3900-ipfilter-basics
- 5. Vigor2960 models with MXIC flash memory cannot be downgraded to firmware prior to 1.2.0.

Check the flash memory type with the CLI command "status system":

Model: Vigor2960

Hardware Version: 1.0 (M) <---- (M) suffix indicates MXIC Flash memory

Hardware Version: 1.0 <----- no suffix indicates Samsung Flash memory, can be

Firmware Version	1.3.1 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Build Date	28 th June 2017
Release Date	27 th July 2017
Revision	7145
Applicable Models	Vigor 2960
Locale	UK & Ireland Only

1. Fast Route functionality added to improve throughput by bypassing firewall processing for specified routed subnets (VPN tunnels etc.). Located in [Routing] > [Fast Route].

- Resolved an issue that could stop the router from resolving DNS hostnames, this would affect any services that resolve hostnames to IP addresses, such as Content Filtering, NTP, Mail Alert, DNS Server etc.
- 2. Improvements to Samba service to ensure immunity to CVE-2017-7494
- 3. Updated SSH server
- 4. Updated App Enforcement signatures to improve handling / blocking of:
 - a. Hotspot
 - b. UltraSurf
 - c. PPstream
 - d. Google Hangouts
- 5. [NAT] > [Server Load Balance] can now balance based on "Source IP"
- 6. Central AP Management can select all managed VigorAPs to apply WLAN Profiles / AP Maintenance tasks
- 7. Resolved an issue with [User Management] > [Web Portal] and SMS authentication
- 8. [User Management] > [User Profile] > Apply All tab could not alter PPTP settings
- 9. IPsec VPN tunnels could not re-establish VPN connection over specified "Failover to" WAN
- 10. Resolved an issue with IPv6 when using an IPv6 WAN configured for DHCPv6 PD (IAID)
- 11. iPad / iPhone devices with iOS 10.3.1 and later could not establish IKEv2 VPN tunnel
- 12. XAuth VPN tunnel could not authenticate if the password contained "#" or "." characters
- 13. The router could not perform DDNS update for "Strato" Dynamic DNS
- 14. Improved PPPoE server efficiency
- 15. IPv6 Ping Diagnostics would not display the ping result
- 16. Resolved a display issue with Switch Management's Switch Hierarchy view

Known Issue

- High Availability Updating from a firmware version <=1.1.0.2: Due to significant changes to High Availability functionality, existing HA configuration will be cleared during the update process and it will be necessary to reconfigure High Availability after the update
- Disable "Force IPsec with L2TP" option in [VPN and Remote Access] > [PPP General Setup] to allow a standard L2TP tunnel, otherwise the L2TP server will allow L2TP with IPsec only
- 3. F/W 1.2.0 onwards Changes the behaviour of the IP Filter. After upgrade some IP Filter rules may need to be reconfigured. Please read the "Filter Rule Actions" segment of this guide for more information on the changes:
 - http://www.draytek.co.uk/support/guides/kb-3900-ipfilter-basics
- 4. Vigor2960 models with MXIC flash memory cannot be downgraded to firmware prior to 1.2.0.

Check the flash memory type with the CLI command "status system":

Model: Vigor2960

Hardware Version: 1.0 (M) <---- (M) suffix indicates MXIC Flash memory

Hardware Version: 1.0 <----- no suffix indicates Samsung Flash memory, can be

Firmware Version	1.3.0 (Formal Release)	
Release Type	Regular – Upgrade recommended when convenient	
Build Date	7 th March 2017	
Release Date	28 th March 2017	
Revision	6930	
Applicable Models	Vigor 2960	
Locale	UK & Ireland Only	

- Support for GRE Tunnel under [VPN and Remote Access] > [VPN Profiles] > [GRE] for compatibility with Cisco routers
- 2. Support for IKEv2 IPsec VPN tunnels
- 3. XAuth authentication support for IPsec Remote Dial-In Teleworker VPN tunnels
- 4. Central AP Management support manage up to 50 VigorAP access points
- 5. Central Switch Management support manage up to 10 VigorSwitch switches
- 6. New interface with improved design for mobile devices available through: https://<router IP>/mobile
- 7. Support for DNSSEC added in [Applications] > [DNS Security]
- 8. The Vigor 2960's own Root CA supports signing certificates generated on other devices / routers in [Certificate Management] > [Remote Certificate]
- 9. [NAT] > [Server Load Balance] added

- 1. The router will notify when another DHCP server is detected
- 2. DHCP options can now specify DHCP Gateway IP Address
- 3. Support dynamic prefix for IPv6 LAN
- 4. WAN Interfaces will default to DHCP when enabled
- 5. High Availability Hot Standby mode can now be switched manually
- 6. Firewall now has a Guest group in [Filter Setup] to apply rules to Guest Profile users
- 7. If Firewall Default Policy is set to Block, option added to "Block All Incoming Traffic"
- 8. Bandwidth Limit now supports "Auto Adjust to make best use of available bandwidth" option
- 9. Bandwidth Limit & Session Limit can now be applied to User Objects, Groups & LDAP
- 10. Added VPN Disconnect Alert Delay to [Notification Object] > [Advanced Setting]
- 11. StartTLS Connection Security supported in [Mail Service Object] & Mail Alert
- 12. Added an option to disable User Login Mail Alert
- 13. Mail Alerts for WAN Status changes now include the WAN IP
- 14. HTTPS Management can now be enforced using Enforce HTTPS Management option, forwards HTTP access attempts to the HTTPS interface
- 15. SSH interface now supports SHA2 authentication
- 16. Timezone configured in Time and Date settings now defaults to UK
- 17. Traffic Graph now displays CPU and Coprocessor usage history graphs
- 18. Added Apply Settings to VigorAP section to TR-069 configuration
- 19. Support for scheduled reboot on weekdays only
- 20. Improvements to the Fail to Ban & Access Barrier functions
- 21. LAN DNS now supports wildcards
- 22. LAN DNS profiles can now perform conditional DNS forwarding when the Type of the LAN DNS profile is set to FORWARD

- 23. Dynamic DNS now supports HTTPS
- 24. Dynamic DNS now supports User Defined mode for custom API configuration
- 25. Google Domains added to Dynamic DNS
- 26. OpenDNS added to Dynamic DNS
- 27. Ping & Trace Route diagnostics can now select which WAN IP Alias to send through
- 28. Added View button to Certificate Management to view loaded certificate details
- 29. Search functionality added to:
 - a. IP Objects & Groups
 - b. Service Type Objects & Groups
 - c. Keyword / DNS Objects
 - d. User Profiles
 - e. VPN Profiles
 - f. NAT Port Redirection rules
- 30. Web Portal can now redirect to specified LAN DNS address instead of IP
- 31. [User Management] > [Web Portal] Login History added
- 32. Clean Deadline button added to Guest Profile to renew usage time of selected account(s)
- 33. Guest Profile accounts can specify max simultaneous logins
- 34. Added Search Button in LDAP to allow users to view and select the Base DN/Group DN
- 35. LDAP now supports SSL connection to LDAP Server
- 36. Improvements to the RADIUS configuration page
- 37. [NAT] > [Port Redirection] can specify allowed Source IP Objects to allow only specified IPs to access port forwards without making Firewall Filter Rules
- 38. Policy Route rules can select Service Type Objects instead of manually specifying ports
- 39. Policy Route rules can now specify Time Objects to apply rules during specified times only
- 40. Added a priority graph to Policy Route rules, click "(?)" to view
- 41. Support for SPF/TXT DNS Records for WAN Inbound Load Balance
- 42. VPN Profiles can now be renamed
- 43. VPN Profiles now display Status icon to indicate connection state
- 44. SSL VPN port can be configured separately from HTTPS management interface
- 45. SSL VPN can be disabled on individual WAN interfaces in [Access Control] to allow NAT Port Redirections to be configured with that port, to the WAN interface with SSL VPN disabled
- 46. Allowed WAN interfaces for PPTP VPN server can be selected in [VPN and Remote Access] > [PPP General Setup]
- 47. IPsec VPN can be set as Default Route/Gateway with Apply NAT Policy enabled for that VPN
- 48. User Profiles can specify allowed VPN Dial-In times by selecting Time Objects
- 49. IPsec proposal DH Group now defaults to G5 (1536-bit)
- 50. Multiple SAs (Security Associations) added to IPsec VPN profiles to specify additional Local & Remote subnets

Known Issue

- High Availability Updating from a firmware version <=1.1.0.2: Due to significant changes to High Availability functionality, existing HA configuration will be cleared during the update process and it will be necessary to reconfigure High Availability after the update
- Disable "Force IPsec with L2TP" option in [VPN and Remote Access] > [PPP General Setup] to allow a standard L2TP tunnel, otherwise the L2TP server will allow L2TP with IPsec only
- 3. F/W 1.2.0 onwards Changes the behaviour of the IP Filter. After upgrade some IP Filter rules may need to be reconfigured. Please read the "Filter Rule Actions" segment of this guide for more information on the changes:
 - http://www.draytek.co.uk/support/guides/kb-3900-ipfilter-basics
- 4. Vigor2960 models with MXIC flash memory cannot be downgraded to firmware prior to 1.2.0.

Check the flash memory type with the CLI command "status system":

Model: Vigor2960

Hardware Version: 1.0 (M) <---- (M) suffix indicates MXIC Flash memory

Hardware Version: 1.0 <----- no suffix indicates Samsung Flash memory, can be

Firmware Version	1.2.2 (Formal Release)
Release Date	24th November 2016
Build Date	1st November 2016
Revision	r6620
Applicable Models	Vigor 2960
Locale	UK ONLY

(None)

Improvements

- 1. FTP connections in Active mode were not passed correctly through NAT
- 2. When using [Diagnostics] > [Data Flow Monitor] > Packet Monitor, results could not be filtered by Host
- 3. Resolved an issue that could cause higher than normal memory usage with some router configurations
- 4. When configuring a User Management profile for VPN with MOTP enabled, it could not be saved without entering a password
- 5. TTL values were reported incorrectly in the [Diagnostics] > [Session Table]
- 6. Improved connectivity for Mac OS X SmartVPN clients

Known Issue

- 5. High Availability Updating from a firmware version <=1.1.0.2: Due to significant changes to High Availability functionality, existing HA configuration will be cleared during the update process and it will be necessary to reconfigure High Availability after the update
- 6. Disable "Force IPsec with L2TP" option in [VPN and Remote Access] > [PPP General Setup] to allow a standard L2TP tunnel, otherwise the L2TP server will allow L2TP with IPsec only
- 7. F/W 1.2.0 onwards Changes the behaviour of the IP Filter. After upgrade some IP Filter rules may need to be reconfigured. Please read the "Filter Rule Actions" segment of this guide for more information on the changes:
 - http://www.draytek.co.uk/support/guides/kb-3900-ipfilter-basics
- 8. Vigor2960 models with MXIC flash memory cannot be downgraded to firmware prior to 1.2.0.

Check the flash memory type with the CLI command "status system":

Model: Vigor2960

Hardware Version: 1.0 (M) <---- (M) suffix indicates MXIC Flash memory

Hardware Version: 1.0 <----- no suffix indicates Samsung Flash memory, can be

Firmware Version	1.2.1 (Formal Release)
Release Date	30th August 2016
Build Date	27th July 2016
Revision	r6367
Applicable Models	Vigor 2960
Locale	UK ONLY

- 1. The router's Online Status can display "Remote DSL" information from a Vigor 130 or Vigor 120v2 modem connected to the router's WAN ports
- 2. Support WAN Load Balance by Session, configured in [Routing] > [Default Route], the default is IP-based Load Balancing
- 3. [Certificate Management] > [Trusted CA Certificate] now supports "Build RootCA" to self-sign certificates
- 4. Packet Monitor facility added to [Diagnostics] > [Data Flow Monitor] to capture WAN/LAN packets and download as a .pcap file
- 5. Web Content Filter Query Server can now be specified in [Objects Setting] > [Web Category Object] > [Query Server] tab

- 1. Efficiency improvements to NAT mechanisms
- 2. SSL VPN supports Idle Timeout and Reconnect
- 3. APP-Enforcement Signature updated to improve handling of:
 - a. IM-Google Hangouts
 - b. Protocol-DNS
 - c. HTTP
 - d. SSL/TLS
 - e. Tunnel-Ultrasurf
 - f. VoIP-RC
 - g. WebHD-HTTP Upload
- 4. Web interface response time improved when displaying large numbers of Profiles (User Profile, IP Objects, etc)
- 5. Improved TCP SYN+FIN filtering mechanism
- 6. Auto DDoS defense added to reduce CPU load if DDoS occurs

Known Issue

- High Availability Updating from a firmware version <=1.1.0.2: Due to significant changes to High Availability functionality, existing HA configuration will be cleared during the update process and it will be necessary to reconfigure High Availability after the update
- Disable "Force IPsec with L2TP" option in [VPN and Remote Access] > [PPP General Setup] to allow a standard L2TP tunnel, otherwise the L2TP server will allow L2TP with IPsec only
- 3. F/W 1.2.1 Changes the behaviour of the IP Filter. After upgrade some IP Filter rules may need to be reconfigured. Please read the "Filter Rule Actions" segment of this guide for more information on the changes: http://www.draytek.co.uk/support/guides/kb-3900-ipfilter-basics
- 4. Vigor2960 models with MXIC flash memory cannot be downgraded to firmware prior to 1.2.0.

Check the flash memory type with the CLI command "status system":

Model: Vigor2960

Hardware Version: 1.0 (M) <---- (M) suffix indicates MXIC Flash memory

Hardware Version: 1.0 <----- no suffix indicates Samsung Flash memory, can be

Firmware Version	1.2.0 (Formal Release)
Release Date	4th December 2015
Build Date	27th November 2015
Revision	r5714
Applicable Models	Vigor 2960
Locale	UK ONLY

- 1. CPU, Memory, Traffic Tx/Rx usage added to [Notification Object], configured under Advanced Setting tab
- 2. [Configuration Backup] > [Analysis] displays details of router configuration on one page
- 3. Auto Firmware Upgrade and Auto Firmware Patch now available to simplify update process
- 4. [User Management] > [Web Portal] new features:
 - a. Can use SMS as an authentication method (requires internet SMS provider configured)
 - b. Option to block mobile devices if required
 - c. Customise login & background images in Portal Page Setup
- 5. MAC/Vendor Object now supported for use with IP Filter
- 6. SMB Server now available under [USB Application] menu for file sharing of connected USB storage
- 7. Now supports SHA2_256 for IPsec VPN tunnel authentication
- 8. SSL VPN port can now be configured as a separate port from HTTPS Management under [System Maintenance] > [Access Control]
- 9. Service Usage Monitor added to [Diagnostics] > [Data Flow Monitor] to observe data usage of specified protocols

- 1. Improvements to the design and functionality of [Applications] > [High Availability]
- 2. Corrected an issue with Port Redirection which could occur after upgrading to 1.1.x firmware
- 3. [Firewall] > [Filter Counter] indicates how many sessions have matched each rule
- 4. General improvements to [Firewall] menus and syslog output
- 5. Improvements to HTTPS filtering when using Web Content Filtering
- 6. Specify Remote IP / Host Name to limit Remote Dial-In VPN connections to that WAN IP / Hostname only
- 7. Bandwidth Limit can now apply to PPTP Remote Dial-In VPN clients
- 8. [Diagnostics] > [ARP Cache Table] now has an option to quickly create an IP Object for listed IP address
- 9. Supports Suffix Type in IPv6 Object configuration
- 10. Time Schedule in Filter Rules can now force sessions to clear when the schedule takes effect
- 11. Spotify can now be blocked with the Application Filter
- 12. Can specify which WAN interfaces can be used for remote management

- 13. Improvements to Traffic Graph and Data Flow Monitor
- 14. QoS Class was not displayed in the Session Table
- 15. Support for "esendex" SMS Provider
- 16. Custom SMS Provider option to define API settings manually for SMS providers not listed

Known Issue

- Due to significant changes to High Availability functionality, existing HA configuration will be cleared during the update process and it will be necessary to reconfigure High Availability after updating to 1.2.0
- 1. Vigor2960 models with MXIC flash memory cannot downgrade to previous firmware versions.

Check the flash memory type with the CLI command "status system":

Model: Vigor2960

Hardware Version : $1.0 \, (M) < ---- \, (M)$ suffix indicates MXIC Flash memory Hardware Version : 1.0 < ----- no suffix indicates Samsung Flash memory, can be downgraded if required

- Disable "Force IPsec with L2TP" option in [VPN and Remote Access] > [PPP General Setup] to allow a standard L2TP tunnel, otherwise the L2TP server will allow L2TP with IPsec only
- 3. F/W 1.2.0 Changes the behaviour of the IP Filter. After upgrade some IP Filter rules may need to be reconfigured. Please read the "Filter Rule Actions" segment of this guide for more information on the changes: http://www.draytek.co.uk/support/guides/kb-3900-ipfilter-basics

Firmware Version	1.1.0.2 (Formal Release)
Release Date	9th September 2015
Build Date	29th August 2015
Revision	r5461
Applicable Models	Vigor 2960
Locale	UK ONLY

(None)

Improvements

- 1. Corrected an issue that could cause Port Redirection to not work after upgrading the firmware from 1.0.9 or earlier
- 2. Syslog to USB was not writing to USB after restarting the router
- 3. It was not possible to modify the max failed Telnet Login attempts before the router bans the IP
- 4. Netbios names were not displaying in the ARP cache table correctly
- 5. Improvements to certificate handling for the router's HTTPS interface
- 6. DNS Suffix (DHCP Option 15) support added for remote dial-in VPN clients
- 7. Upgraded OpenSSL to 0.9.8zg for security updates
- 8. Resolves a WAN connectivity issue that could occur after an extended duration

Known Issue

 Disable "Force IPsec with L2TP" option in [VPN and Remote Access] > [PPP General Setup] to allow a standard L2TP tunnel, otherwise the L2TP server will allow L2TP with IPsec only

Firmware Version	1.1.0.1 (Formal Release)
Release Date	31st July 2015
Build Date	16th July 2015
Revision	r5291
Applicable Models	Vigor 2960
Locale	UK ONLY

(None)

Improvements

- 1. Resolved issue that could cause PPTP Remote Dial In throughput reduction
- 2. Corrected issue that could cause Port Redirection to not work after upgrading the firmware from 1.0.9 or earlier
- 3. Corrected NAT Loopback issue for PPTP dial-in user accessing WAN IP alias
- 4. IPv6 could not get public IP via DHCP IA PD.
- 5. LAN to LAN for SSL VPN would not re-connect automatically after VPN disconnection
- 6. Incorrect remote IP address displayed for SSL VPN in connection history
- 7. SNMP deamon correction
- 8. Corrected issue that could prevent Policy route via NAT from working
- 9. Corrected issues that could prevent TR-069 from working in some configurations
- 10. Change profile number for Policy Route to 120, and for Static Route to 200

Known Issue

1. You need to disable "Force IPsec with L2TP" options for pure L2TP tunnel in [VPN and Remote Access] > [PPP General Setup].

Firmware Version	1.1.0 (Formal Release)
Release Date	19th June 2015
Build Date	6th June 2015
Revision	r5142
Applicable Models	Vigor 2960
Locale	UK ONLY

- 1. SSL VPN LAN to LAN tunnel (Supported from DrayTek Vigor 2960 / 3900 1.1.0 firmware and Vigor 2860 / 2925 3.8.x firmware).
- 2. Internal RADIUS server under [User Management] > [RADIUS].
- 3. APP Enforcement supported app list added under [Objects Settings] > [APP Support List].
- 4. Added auto/manual APP Signature Upgrade setting page in [System Maintenance] > [APP Signature Upgrade]
- 5. [System Maintenance] > [Access Control] Improvements:

Validation Code in Access Control tab to improve web admin security; Fail to Ban setting page to automatically block IP addresses after failed login attempts;

Access Barrier setting page to protect router services (WUI, FTP etc) from brute force attack.

- 6. Added Switch Rate Limit setting page in [Firewall] > [Dos Defense].
- 7. Added [NAT] > [Connection Timeout] to allow altering the session timeout of different traffic types i.e. TCP, UDP etc
- 8. Wake on LAN can now operate on a schedule by configuring profiles in [Applications] > [Wake on LAN] > [Schedule Wake on LAN]
- 9. [Diagnostics] > [MAC Address Table] added.
- 10. [Diagnostics] > [User Status] added, to show PPPoE / Web Portal / VPN / SSL Proxy users in one location.
- 11. [LAN] > [LAN DNS] now supports wild-card strings and CNAME records for individual LANs using the Specified LAN option.
- 12. [Routing] > [Policy Route] Improvements:

Priority options (Normal, High, Top) for more flexible routing.

Country Objects as destination addresses.

Failover options for target IP ping failure.

- 13. Support for Multicast via VPN.
- 14. Router's web interface can now notify of new firmware upgrades available.

Improvements

- 1. Improved DDoS protection.
- 2. SSL VPN settings now available under [VPN and Remote Access] > [PPP General Setup].
- 3. PPTP Dial-In VPN Profile (LAN to LAN) now supports multiple remote subnets.
- 4. LDAP/RADIUS support for the router's SSL Proxy facility.
- 5. [User Management] > [Web Portal] > [Portal Page Setup] now supports uploading an HTML file as the bulletin message.
- 6. Packet Inspection settings added under [Firewall] > [Filter Setup] > [Default Policy]
- 7. [User Management] > [User Profile] > [Apply All] improved to allow multiple choice.
- 8. Port Statistics now shown under [Diagnostics] > [Traffic Statistics].
- 9. Session Information added to [Diagnostics] > [Traffic Graph].
- 10. Vendor Information added to [Diagnostics] > [ARP Cache Table].
- 11. Daily / Period timout settings added to Web Portal under [User Management] > [Web Portal] > [General Setup].
- 12. Bind IP to MAC can now be applied to specific subnets.
- 13. Supported added for VPN routing through GRE over IPSec tunnel (VPN Trunk).
- 14. Keep VPN Setting option added to [Central VPN Management] > [CPE Management].
- 15. Alert interval of temperature sensor now configurable under [USB Application] > [Temperature Sensor] > [General Setup].
- 16. The router could not use a DNS server located on the LAN for DNS queries under some circumstances.
- 17. Traffic was unable to pass between LAN and PPPoE server clients.
- 18. Web Content Filter category selection page improvements.
- 19. IP Filter now shows a counter display for matched packets.

Known Issue

1. You need to disable "Force IPsec with L2TP" options for pure L2TP tunnel in [VPN and Remote Access] > [PPP General Setup].

Firmware Version	1.0.9.1 (Formal Release)
Release Date	16th February 2015
Build Date	30th January 2015
Revision	r4763
Applicable Models	Vigor 2960
Locale	UK ONLY

(None)

Improvements

- 1. The IGMP Proxy feature's compatibility with some ISPs that use PPPoE has been improved.
- 2. Support for the Bandluxe C330 USB 3G modem.
- 3. SSL VPN now changes tunnel MTU in relation to the WAN MTU.
- 4. PPTP Dial-In User VPN connections could not access the internet under some circumstances.
- 5. Policy Route was not working with return path traffic.
- 6. The IPsec option "Auto Dial Out if WAN1 Down" was still taking effect after being disabled in the WUI.
- 7. The router's memory usage was higher than normal when using the Data Flow Monitor.
- 8. The Access Control List was not working correctly under some circumstances.
- 9. Improvements to ensure immunity to Ghost/CVE-2015-0235

Known Issue

1. You need to disable "Force IPsec with L2TP" options for pure L2TP tunnel in VPN and Remote Access >> PPP General Setup.

Firmware Version	1.0.9 (Formal Release)
Release Date	29th October 2014
Build Date	21st October 2014
Revision	r4394
Applicable Models	Vigor 2960
Locale	UK ONLY

- 1. Improve SSL VPN throughput for SSL VPN tunnel mode with Smart VPN Client 4.3.1 or later.
- 2. Supports USB 4G/LTE. Check [USB]-[Modem support list] in the router's web interface for details.
- 3. Supports USB disk /FTP server.
- 4. Supports saving Syslog to USB disk.
- 5. Supports Policy Route (replacing Load Balance Rule and Address Mapping menus).

- 1. Corrected: Connection request notifications from Vigor ACS were not authenticated
- 2. Corrected: Can't establish IPv6 static connection.
- 3. Improved: IPSec VPN tunnel can now be configured to pass or block NetBios packets.
- 4. Improved: Allow downloading/uploading private key (for Host to LAN VPN by X.509).
- 5. Improved: Show the VPN Type/Form fields on VPN History web page.
- 6. Improved: Handling for Duplicated Routes (with Static Route Metric). When the static route metric is <=10, the priority of that static route will be greater than a VPN route.
- 7. Improved: Support QoS for VoIP traffic from LAN.
- 8. Improved: Support "Ping to Keep Alive" feature for detecting whether an IPsec tunnel is able to pass traffic
- 9. Improved: Support WAN Port and IP Alias options for PPTP Dial Out connection.
- 10. Improved: Support RFC 4638 (accommodating an MTU/MRU larger than 1492 for PPPoE protocol WAN connections).
- 11. Improved: Added STUN server option to TR-069 settings.
- 12. Improved: Added Jumbo Frame setting under [LAN]-[Switch]-[Jumbo Frame] to edit Maximum Frame size.
- 13. Improved: Added a "Clear" button for the DDNS settings page.
- 14. Improved: Bind IP to MAC can now export or import a list of IP / MAC addresses.
- 15. Improved: [Sytem Maintenance] [Access Control] can now be configured to accept pings from the WAN on specified WAN interfaces.
- 16. Improved: Added "OVH" as service provider for DDNS setting.
- 17. Improved: Supports Range-to-many Port Redirection.
- 18. Improved: Improve login page customization for Web Portal setup.
- 19. Improved: Change mechanism of deleting objects.
- 20. Improved: Upgrade OpenSSL to 0.9.8zc for SSLv3 Fallback (CVE-2014-3566) protection.

Firmware Version	1.0.8.2 (Formal Release)
Release Date	14th July 2014
Build Date	13th June 2014
Revision	r3968
Applicable Models	Vigor 2960
Locale	UK ONLY

(None)

Improvements

- 1. Update OpenSSL to 0.9.8za
- 2. WCF (Web Content Filter) updated for Service Name from Commtouch to Cyren.
- 3. Resolved some HA (High Availability) issues
- 4. Corrected issue with DDNS failover 3G WAN

Known Issue

- 1. VPN Trunk tunnel doesn't work well when the profile name is more than 15 characters.
- 2. You need to disable "Force IPsec with L2TP" options for pure L2TP tunnel in VPN and Remote Access >> PPP General Setup.

Firmware Version	1.0.8.1 (Formal Release)
Release Date	17th June 2014
Build Date	22th May 2014
Revision	r3863
Applicable Models	Vigor 2960
Locale	UK ONLY

(None)

- 1. PPTP connection stability.
- 2. Web Portal stability.
- 3. Remove management port setting which may occupy port redirection.
- 4. Improve the stability of High Availability function.
- 5. Add telnet timeout if not login in 60 seconds.
- 6. CPU usage is too high when data flow monitor is enabled.
- 7. SSL VPN client fixed
- 8. A problem of WCF license occurred when HA is enabled.
- 9. CVM can't perform configuration backup.
- 10. NAT Loopback to LAN More Subnet doesn't work.
- 11. DNS for PPTP Remote dial-in is not assigned according to the LAN Profile.
- 12. Reboot with Customized Configurations bug.
- 13. When firewall default policy (block) is used, HTTP is still available for access.
- 14. Web portal still supports URL redirect when login mode is disabled.
- 15. Packet count error when PPTP acceleration is enabled.
- 16. mOTP User profile cannot be saved without Password.
- 17. WAN Priority Bits doesn't work.
- 18. An error occurred in time object.
- 19. An error occurred in WAN >> Switch mode >> double tag.

Firmware Version	1.0.8 (Formal Release)
Build Date	10th March 2014
Revision	r3548
Applicable Models	Vigor 2960
Locale	UK ONLY

- 1. Same WAN VLAN ID can be used in different WAN interfaces. (WAN >> General Setup Mode: Advance, Switch Mode: Double Tag)
- 2. QoS for multiple WANs.
- 3. SNMP v3 Support
- 4. Support country block for Firewall.
- 5. Support WCF white list.
- 6. Support LAN DNS server.
- 7. BGP routing protocol Support
- 8. SSL VPN tunnel mode (up to 20 tunnels).
- 9. Support Web Portal and Hotspot (Guest profile) in User Management.
- 10. Support PPTP acceleration for PPTP WAN/Remote Dial-in/LAN to LAN (90Mbps with MPPE, 400Mbps without MPPE).
- 11. Support QoS retag option.
- 12. Support VPN dial-out failover if WAN disconnected.
- 13. Support VPN LAN to LAN for overlap/duplicate subnets.
- 14. High Availability Support.
- 15. Display the last UP/DOWN log of VPN profile.
- 16. Add default policy for Firewall and default block policy can be applied.
- 17. Add IPv6 firewall settings.
- 18. Add DNS object.
- 19. Add a remote capture telnet command (rc), for traffic monitor and wireshark remote capture.
- 20. Add front panel and VPN status on the dashboard.

- 1. Change the menu item "User Management>>General Setup" into "User Management>>Web Portal".
- 2. Move IP Routing from LAN to Static Route and rename as LAN/WAN Proxy ARP.
- 3. Move Inter-LAN Route from LAN>>Static Route to LAN>>General Setup.
- 4. Move status page to the first tab of each function menu.
- 5. Support RADIUS, LDAP, Local authentication in User Management.
- 6. Support NAT option for IPsec LAN to LAN.
- 7. Support LDAP profile in Firewall.
- 8. Support ratio configuration for VPN Load Balancing.
- 9. Port number setting for Access Control in WAN IP alias can be passed to LAN by default.
- 10. Notification object can be recorded on Syslog through the configuration on
- 11. Applications>>SMS/Mail Alert Service page.

- 12. 11 Support Local/RADIUS/LDAP authentication for PPTP/L2TP/PPPoE server at the same time.
- 13. Change the priority of Inter-LAN route, that IP filter can do further control.
- 14. Support connection failover for TR-069.
- 15. Display router name in web page title.
- 16. IPsec VPN dial-in connection with all WANs is supported in default.
- 17. Support RFC3021.
- 18. Combine IM/P2P/Protocol object to App Object for blocking more Apps.
- 19. The number of Management Access Control List is increased up to 16.
- 20. Support peer identity for IPsec RSA authentication.
- 21. Support password encode option for configuration backup.
- 22. Support more special characters in username for user profile.
- 23. The number of SSL web proxy/VNC/RDP profile is increased up to 30.
- 24. Support customized DDNS.
- 25. Support acceleration of fragmented UDP packets (maximum 1628 bytes).
- 26. Support DHCP option 95 (LDAP server), 161(FTP server), and 162 (File path) for DHCP server.
- 27. Support more subnet DHCP servers in Bind IP to MAC.
- 28. Support DHCP relay over LAN/Non-Direct-Connected LAN.
- 29. Support DHCP relay settings for PPTP/L2TP/PPPoE.
- 30. Support open port to the host in remote VPN network.
- 31. Default route cannot work well when two WAN IPs are in the same IP network.

Firmware Version	1.0.7.1 (Formal Release)
Release Date	13th November 2013
Build Date	12th November 2013
Revision	r3067
Applicable Models	Vigor 2960
Locale	UK ONLY

(None)

Improvements

- 1. Support USB-WAN for WAN Profile under the Setting tab in Application>> Dynamic DNS.
- 2. Modify the mechanism for IP filter, "if no further match" action.
- 3. Add a subnet mask setting, 255.255.254, for WAN IP configuration.
- 4. Added option disable negotiation for Fiber WAN under the Interface tab in WAN>>Switch.
- 5. QoS IP rule can apply the packets passing through both Local IP and Remote IP.
- 6. 'space' special character can be used in the username for LDAP
- 7. Improved PPTP service mechanism for multiple simultaneous LAN to LAN dial-ins
- 8. Corrected: Cannot block / unblock some IPs on Diagnostics>>Data Flow Monitor.
- 9. Corrected issue with ICMP packets larger than 8138 bytes over IPSec LAN to LAN tunnel.
- 10. Corrected: The user cannot access Internet when QoS queue weight is set as "0".
- 11. Corrected: Lower the priority of Inter-LAN routing function.
- 12. Corrected: LAN DHCP packets do not respond while LAN DHCP Server is OFF.
- 13. Corrected: Can't accept L2TP VPN from (None) default route WAN.
- 14. Corrected: RADIUS client (Vigor router) sends wrong NAS IP address (127.0.0.1).
- 15. Corrected traffic status of DHCP over IPsec in VPN Connection Management.
- 16. ARP detection may fail when WAN TX traffic is full.
- 17. Corrected: SMS can't be sent out when L2TP over IPsec is up and down.

Known Issue

- 1. VPN Trunk tunnel doesn't work well when the profile name is more than 15 characters.
- 2. You need to disable "Force IPsec with L2TP" options for pure L2TP tunnel in [VPN and Remote Access]>[PPP General Setup]

Firmware Version	1.0.7 (Formal Release)
Build	r2733
Release Date	2nd Sept 2013
Applicable Models	Vigor 2960
Locale	UK ONLY

- 1. Support Central VPN Management (CVM). Up to 12 devices can be managed.
- 2. Support 3G backup/load balance.
- 3. Support inbound load balance.
- 4. Support VPN Trunk failover mode.
- 5. Support PPPoE quota setting and MAC address filter.
- 6. Support USB temperature sensor. http://www.draytek.co.uk/products/usb-thermometer.html
- 7. Support SMS, Email Alert and Notification object profiles for WAN/VPN connection and USB temperature sensor.
- 8. Support Bridge VLAN function for LAN/WAN bridging.

Improvements

- 1. Improved: Support SmartMonitor users up to 200.
- 2. Improved: VPN Trunk throughput and stability.
- 3. Improved: By default disable insecure SSL Encryption Key Algorithms
- 4. Improved: Support DHCP relay on VPN.
- 5. Improved: QoS redesigned
- 6. Improved: Username reported to Syslog
- 7. Improved: Add option 60(Vendor ID), 61(Client ID) for WAN DHCP mode.
- 8. Improved: Add default maximum session number for Session limit.
- 9. Improved: Add flow control settings for Switch.
- 10. Improved: Add user defined options for DHCP server.
- 11. Improved: Improve DMZ function.
- 12. Improved: Add log and force update function for DDNS.
- 13. Improved: Add Force L2TP with IPsec policy option enabled in default.
- 14. Improved: Corrected causes for high CPU usage being displayed in Web UI
- 15. Improved: Stability in TR-069.
- 16. Improved: Firmware upgrade speed.
- 17. Fixed: Time object cannot work correctly when daylight saving is enabled.

Known Issue

- 1. VPN Trunk tunnel doesn't work well when the profile name is more than 15 characters.
- 2. You need to disable "Force IPsec with L2TP" options for pure L2TP tunnel in [VPN and Remote Access]>[PPP General Setup]

Firmware Version	1.0.6.2 (Formal Release)
Build	r2215
Release Date	5th July 2013
Applicable Models	Vigor 2960
Locale	UK ONLY

(None)

- 1. Resolved LAN port inter-operability issue that could cause the Vigor 2960 to disconnect from the LAN after a period of time
- 2. WAN re-connection could trigger VPN trunk to disconnect

Firmware Version	1.0.6.1 (Formal Release)
Release Date	26th April 2013
Applicable Models	Vigor 2960
Locale	UK ONLY

(None)

- 1. Improved the throughput among different VLANs.
- 2. Add support for VPN on Alias WAN IP and IP Routing IP.
- 3. Send ARP of WAN Alias IP to WAN Gateway when connected.
- 4. Configuration Backup menu improved
- 5. Added more parameters and improved the stability for TR-069.
- 6. NAT Port Redirection Rule for FTP server didn't work when two WAN connections are up.
- 7. Customized web content message disappears after rebooting the router.
- 8. VPN Trunk tunnel didn't work well when the profile name was long.
- 9. Corrected display error for PPTP connection in VPN Graph on Syslog.
- 10. Ping to VPN remote network didn't work after clicking WAN DHCP Renew
- 1. Button via web user interface.
- 11. Session limit applied the incorrect limit due to error in calculating mask.
- 12. WAN status was up while WAN cable was unplugged and WAN detection mode was set to "None"
- 13. Something wrong with SNMP Set/Get Community.
- 14. VPN Traffic could not pass anymore while one of the VPN GRE tunnels was disconnected.
- 15. Corrected DHCP renew interoperability issue with some ISPs.
- 16. Corrected SIP ALG
- 17. IPSec tunnel uptime might not reset whene tunnel disconnected and re-established
- 18. Corrected issue with PPTP control session that could prevent new connections.
- 19. A PC from remote subnet via PPTP LAN to LAN couldn't access into Internet via VPN
- 20. Improved handling of certain IPv6 packets.
- 21. Corrected Load balance error when using multiple PPPoE connection with the same gateway.

Firmware Version	1.0.6 (Formal Release)	
Release Date	12th December 2012	
Applicable Models	Vigor 2960	
Locale	UK ONLY	

- 1. Support VPN (IPsec) Routing Acceleration.
- 2. Support VPN Alarm via E-mail & Syslog.
- 3. Support VPN Graph for Syslog utility.
- 4. Support PPPoE server for LAN PC connection.
- 5. Add QQ account filter.
- 6. Add LDAP/AD for VPN PPTP, L2TP authentication.
- 7. URL Content Filter can block HTTPS connection by host keyword.
- 8. Improved: WCF (Web Content Filter) supports HTTPS block by web category.

Firmware Version	1.0.5 (Formal Release)	
Release Date	17th August 2012	
Applicable Models	Vigor 2960	
Locale	UK ONLY	

First Firmware Release

[END OF FILE]