

Release Notes for DrayTek VigorAP 1000c (UK/Ireland)

Firmware Version	1.4.3 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Release Date	29 th June 2022
Build Date	05 th May 2022
Revision	g1388_ecc1902d45
Applicable Models	VigorAP 1000c
Locale	UK Only

New Features

1. Added default DHCP client ID for identification of the VigorAP on the network
2. Support for CLI AP Management over SSH
3. Hotspot Web Portal feature can be activated on [LAN] > [Hotspot Web Portal]
4. Manage up to 30 VigorAP access points by enabling “RootAP” mode from [Central AP Management] > [General Setup]

Improvements

1. Added master AP group ID and group key for use with AP-based AP management
2. Updated HTTPS mechanism to address the CVE-2022-0778 (OpenSSL)
3. Support for DrayTek Wireless APP configuration backup/restore option
4. The default setting for 2.4GHz channel selection is now ‘Auto select’
5. Added notification about VigorAP reboot after finishing the firmware upgrade process
6. Notification of Management VLAN not being compatible with Mesh added to GUI
7. WiFi stability improvements
8. LAN-B details were displayed in Vigor Central APM when 2nd subnet was disabled
9. Wireless clients connected to different SSIDs on the same radio band could not communicate with each other
10. Improved the mesh network stability
11. In some circumstances the mesh node could disconnect from the mesh root
12. ‘LAN-B’ option on [Wireless LAN] > [General Setup] could not be saved
13. Updated wireless chipset drivers to resolve CVE-2020-26139 to CVE-2020-26145, CVE-2020-24586 to CVE-2020-24588

Known Issues

1. Single band performance may drop when Bonding is enabled
-


Firmware File Types

The file name of the firmware controls which upgrade type is performed. If the file name is unchanged (e.g. xxxx.all) then the upgrade will just upgrade the firmware, whereas renaming the firmware to a .rst extension will wipe all settings back to factory defaults when upgrading the firmware.

Upgrade Instructions

It is recommended that you take a configuration backup prior to upgrading the firmware. This can be done from the AP's system maintenance menu.

To upgrade firmware, select '*firmware upgrade*' from the AP's system maintenance menu and select the correct file. The access point will perform the upgrade and automatically reboot once this completes.

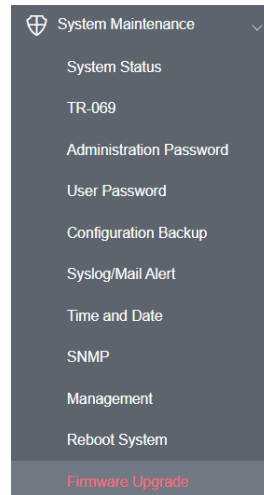

Manual Upgrade

If you cannot access the AP's menu, you can put the AP into 'TFTP' mode by holding the FACTORY RESET button whilst turning the unit on and then use the Firmware Utility. That will enable TFTP mode. TFTP mode is indicated by all LEDs flashing. This mode will also be automatically enabled by the router if there is a firmware/settings abnormality. Upgrading from the web interface is easier.

Firmware Version	1.4.0 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Release Date	23 rd March 2021
Build Date	03 rd February 2021
Revision	g449_385ef6e55c
Applicable Models	VigorAP 1000c
Locale	UK Only

New Features

(None)

Improvements

1. Updated MyVigor authentication method
2. Mesh Root enters 'Register' state automatically when the Isolated Wired Mesh Node in Group List is detected
3. Port 9608 TCP is now closed when Mesh Root / Root AP mode is disabled
4. In some circumstances mail alert option did not work
5. In some conditions, 2.4GHz clients could not connect to the AP after a few days with AP-Assisted Roaming enabled
6. Image could not be displayed properly on Quick Start Wizard page
7. Corrected configuration mechanism for [Wireless LAN (5GHz)] > [Access Control]
8. Wireless VLAN ID did not work when LACP was enabled

Known Issues

1. Single band performance may drop when Bonding is enabled

Firmware Version	1.3.5 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Release Date	18 th November 2020
Build Date	27 th October 2020
Revision	g185_44618f4ab6
Applicable Models	VigorAP 1000c
Locale	UK Only

New Features

1. Support for new Wireless Security modes:
 - a. WPA3/WPA2 Personal
 - b. WPA3 Enterprise
 - c. WPA3/WPA2 Enterprise
2. New [Mesh] > [Mesh Syslog] added for mesh diagnostics
3. [Mesh] > [Support List] section added to check Mesh features of other VigorAPs & Routers

Improvements

1. HTTPS management no longer supports 3DES ciphers
2. Mesh Preferred Uplink Timeout option added
3. The wireless security type naming and order updated
4. The last sync update time information on the [Mesh] > [Mesh Setup] page added
5. An alert will be displayed when wireless settings that will disable WMM are selected
6. Updated message shown for 802.11n speed limitations with WEP / WPA security modes
7. Corrected Quick Start Wizard page AP image
8. Special characters such as '-' can now be used with Mesh Root administrator password

Known Issues

1. Single band performance may drop when Bonding is enabled

Firmware Version	1.3.4 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Release Date	11 th August 2020
Build Date	11 th June 2020
Revision	12217
Applicable Models	VigorAP 1000c
Locale	UK Only

New Features

1. Bonding feature allows both Ethernet interfaces to be connected to a switch for better bandwidth throughput

Improvements

1. [System Maintenance] > [Administration Password] credentials can contain "-" character
2. Refine Wireless Security options on web [Wireless LAN] > [Security] where PSK is now called Personal, e.g. WPA2 Personal and 802.1x is named Enterprise, e.g. WPA2 Enterprise
3. Mesh Root can now control Mesh Nodes from [Mesh] > [Mesh Status] with "Disconnect" and "Reselect" actions available for the AP operating as the Mesh Root
4. Mesh Nodes can now have their preferred next 'hop' specified as the "Preferred Uplink" on the [Mesh] > [Mesh Setup] page of an AP operating as a Mesh Node
5. The Reset Button can be disabled from [System Maintenance] > [Management] page
6. In Mesh mode, disabling all wireless bands will produce a warning message
7. Mesh syslog improvements
8. Fixed errors on [Quick Start Wizard] > [Operation Mode] page
9. The button would not work properly on [Mobile Device Management] > [Station List]
10. Improved MyVigor compatibility with the new DrayTek MAC Address OUI beginning with "14:49:BC"

Known Issues

1. Single band performance may drop when Bonding is enabled

Firmware Version	1.3.3 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Release Date	15 th April 2020
Build Date	24 th March 2020
Revision	11831
Applicable Models	VigorAP 1000c
Locale	UK Only

New Features

(None)

Improvements

1. Improved SNMP functionality
2. Improved GUI for [Mesh] > [Mesh Setup] wizard for Mesh Root
3. AP displays SSID for 5GHz wireless station in [Station List] > [Clients List]
4. Wireless security improvements for 802.1x
5. Improvements to DHCP Server
6. Access Control would not work when wireless security was set to WPA3-Personal

Known Issues

(None)

Firmware Version	1.3.2 (Formal Release)
Release Type	Initial Release
Release Date	9 th March 2020
Build Date	14 th January 2020
Revision	11481
Applicable Models	VigorAP 1000c
Locale	UK Only

First Firmware Release for this model

Known Issues

(None)

[END OF FILE]