Release Notes for DrayTek VigorAP 920RPD (UK/Ireland)

Firmware Version	1.3.5 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Release Date	18 th November 2020
Build Date	27 th October 2020
Revision	g185_44618f4ab6
Applicable Models	VigorAP 920RPD, VigorAP 920R
Locale	UK Only

New Features

- 1. Support for new Wireless Security modes:
 - a. WPA3/WPA2 Personal
 - b. WPA3 Enterprise
 - c. WPA3/WPA2 Enterprise
- 2. New [Mesh] > [Mesh Syslog] added for mesh diagnostics
- 3. [Mesh] > [Support List] section added to check Mesh features of other VigorAPs & Routers

Improvements

- 1. HTTPS management no longer supports 3DES ciphers
- 2. Mesh Preferred Uplink Timeout option added
- 3. The wireless security type naming and order updated
- 4. The last sync update time information on the [Mesh] > [Mesh Setup] page added
- 5. An alert will be displayed when wireless settings that will disable WMM are selected
- 6. Updated message shown for 802.11n speed limitations with WEP / WPA security modes
- 7. Corrected Quick Start Wizard page AP image
- 8. Special characters such as '-' can now be used with Mesh Root administrator password

Known Issues

(None)	١
--------	---


Firmware File Types

The file name of the firmware controls which upgrade type is performed. If the file name is unchanged (e.g. xxxx.all) then the upgrade will just upgrade the firmware, whereas renaming the firmware to a .rst extension will wipe all settings back to factory defaults when upgrading the firmware.

Upgrade Instructions

It is recommended that you take a configuration backup prior to upgrading the firmware. This can be done from the AP's system maintenance menu.

To upgrade firmware, select 'firmware upgrade' from the AP's system maintenance menu and select the correct file. The access point will perform the upgrade and automatically reboot once this completes.

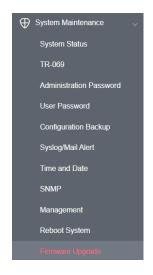

Manual Upgrade

If you cannot access the AP's menu, you can put the AP into 'TFTP' mode by holding the FACTORY RESET button whilst turning the unit on and then use the Firmware Utility. That will enable TFTP mode. TFTP mode is indicated by all LEDs flashing. This mode will also be automatically enabled by the router if there is a firmware/settings abnormality. Upgrading from the web interface is easier.

Firmware Version	1.3.4 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Release Date	5 th August 2020
Build Date	11 th June 2020
Revision	12217
Applicable Models	VigorAP 920RPD, VigorAP 920R
Locale	UK Only

(None)

Improvements

- 1. [System Maintenance] > [Administration Password] credentials can contain "-" character
- Refine Wireless Security options on web [Wireless LAN] > [Security] where
 PSK is now called Personal, e.g. WPA2 Personal
 and 802.1x is named Enterprise, e.g. WPA2 Enterprise
- 3. Mesh Root can now control Mesh Nodes from [Mesh] > [Mesh Status] with "Disconnect" and "Reselect" actions available for the AP operating as the Mesh Root
- 4. Mesh Nodes can now have their preferred next 'hop' specified as the "Preferred Uplink" on the [Mesh] > [Mesh Setup] page of an AP operating as a Mesh Node
- 5. The Reset Button can be disabled from [System Maintenance] > [Management] page
- 6. In Mesh mode, disabling all wireless bands will produce a warning message
- 7. Mesh syslog improvements
- 8. Fixed errors on [Quick Start Wizard] > [Operation Mode] page
- 9. The button would not work properly on [Mobile Device Management] > [Station List]
- 10. Improved MyVigor compatibility with the new DrayTek MAC Address OUI beginning with "14:49:BC"

Known Issues

Firmware Version	1.3.3 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Release Date	15 th April 2020
Build Date	24 th March 2020
Revision	11831
Applicable Models	VigorAP 920RPD, VigorAP 920R
Locale	UK Only

(None)

Improvements

- 1. Improved SNMP functionality
- 2. Improved GUI for [Mesh] > [Mesh Setup] wizard for Mesh Root
- 3. AP displays SSID for 5GHz wireless station in [Station List] > [Clients List]
- 4. Wireless security improvements for 802.1x
- 5. Improvements to DHCP Server
- 6. Access Control would not work when wireless security was set to WPA3-Personal

Known Issues

Firmware Version	1.3.2 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Release Date	18 th February 2020
Build Date	14 th January 2020
Revision	11481
Applicable Models	VigorAP 920RPD, VigorAP 920R
Locale	UK Only

- 1. Support for WPA3
- 2. Multi-SSID (VLAN) over Mesh support added
- 3. Speed-test between Mesh node & Mesh root via web

Improvements

- 1. Device Object added and integrated with WLAN access control & schedule
- 2. Mobile Device Management interface updated
- 3. Mesh Node delete option added
- 4. Advanced Config Sync for Mesh networks added for Roaming, Band Steering, Access Control and other advanced AP configuration settings
- 5. Vigor router APM compatibility updated
- 6. Mesh node management by VigorACS server improved

Known Issues

Firmware Version	1.3.1 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Release Date	16 th September 2019
Build Date	20 rd July 2019
Revision	10662
Applicable Models	VigorAP 920RPD, VigorAP 920R
Locale	UK Only

(None)

Improvements

1. Updates to TLS mechanism for compatibility with VigorACS 2.5.0

Known Issues

Firmware Version	1.3.0 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Release Date	25 th July 2019
Build Date	23 rd May 2019
Revision	10414
Applicable Models	VigorAP 920RPD, VigorAP 920R
Locale	UK Only

- 1. New WebUI design
- 2. Support for DrayTek Mesh
- 3. Support for DrayTek Wireless APP
- 4. Support for IGMP Snooping
- 5. Accept the access control list transferred by VigorACS 2

Improvements

- 1. OpenSSL updated to 1.0.20
- 2. Default security mode of all SSIDs set to WPA2/PSK
- 3. Warning message added about WPA2 key complexity when Fast Roaming is enabled
- 4. "Allow management from WLAN" option and Access List added
- 5. DHCP clients of the AP can access AP web via http://vigorap.com
- 6. New Syslog categories added (Syslog Tools 4.5.7)
- 7. Password check added in [System Maintenance] > [Configuration Backup]
- 8. When configuring [RADIUS Setting] > [RADIUS Server], strings for a group of username and password with total characters of more than 20 would be shown incorrectly
- 9. Unable to create a Root CA certificate if CN composed with two strings is separated by white space

Known Issues

Firmware Version	1.2.5 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Release Date	18 th December 2018
Build Date	9 th November 2018
Revision	9469
Applicable Models	VigorAP 920RPD, VigorAP 920R
Locale	UK Only

- 1. Support for the VigorAP 920RPD
- 2. 5GHz Antenna mode is controlled from [Wireless LAN (5GHz)] > [Advanced Setting] by selecting Dipole (external) and Patch (internal) Antenna modes

Improvements

1. Improved reliability of [Diagnostics] > [Wireless Speed Test]

Known Issues

Firmware Version	1.2.4 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Release Date	26 th November 2018
Build Date	27 th July 2018
Revision	9310
Applicable Models	VigorAP 920RPD, VigorAP 920R
Locale	UK Only

1. Support for the VigorAP 920RPD

Improvements

(None)

Known Issues

Firmware Version	1.2.3 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Release Date	15 th August 2018
Build Date	27 th July 2018
Revision	8899
Applicable Models	VigorAP 920R
Locale	UK Only

(None)

Improvements

- 1. Improved compatibility of the VigorAP's web interface with Internet Explorer
- 2. Wireless WDS connections were truncated when AP's IP address was set via DHCP

Known Issues

Firmware Version	1.2.1
Release Type	Initial Release
Release Date	8 th August 2018
Build Date	26 th March 2018
Revision	8162
Applicable Models	VigorAP 920R
Locale	UK Only

First Firmware Release for this model

[END OF FILE]