

## **Release Notes for DrayTek VigorAP 960c (UK/Ireland)**

Firmware Version	1.4.5 (Formal Release)
Release Type	<b>Regular</b> – Upgrade recommended when convenient
Release Date	2 <sup>nd</sup> September 2022
Build Date	5 <sup>th</sup> August 2022
Revision	g1460_09cc32292e
Applicable Models	VigorAP 960c
Locale	UK Only

### **New Features**

(None)

### **Improvements**

1. Vigor router's Central AP Management could fail with VigorAP 960C access points after upgrading to 1.4.4 firmware

### **Known Issues**

(None)

---


## Firmware File Types

The file name of the firmware controls which upgrade type is performed. If the file name is unchanged (e.g. xxxx.all) then the upgrade will just upgrade the firmware, whereas renaming the firmware to a .rst extension will wipe all settings back to factory defaults when upgrading the firmware.

## Upgrade Instructions

It is recommended that you take a configuration backup prior to upgrading the firmware. This can be done from the AP's system maintenance menu.

To upgrade firmware, select '*firmware upgrade*' from the AP's system maintenance menu and select the correct file. The access point will perform the upgrade and automatically reboot once this completes.

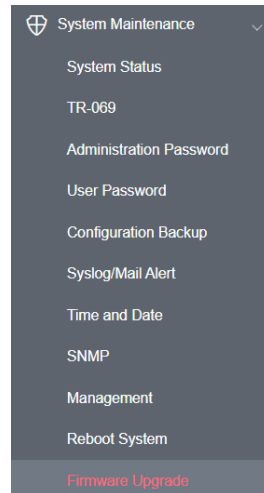

## Manual Upgrade

If you cannot access the AP's menu, you can put the AP into 'TFTP' mode by holding the FACTORY RESET button whilst turning the unit on and then use the Firmware Utility. That will enable TFTP mode. TFTP mode is indicated by all LEDs flashing. This mode will also be automatically enabled by the router if there is a firmware/settings abnormality. Upgrading from the web interface is easier.

Firmware Version	1.4.4 (Formal Release)
Release Type	<b>Regular</b> – Upgrade recommended when convenient
Release Date	30 <sup>th</sup> June 2022
Build Date	06 <sup>th</sup> May 2022
Revision	g1405_88af2ade15
Applicable Models	VigorAP 960c
Locale	UK Only

### **New Features**

(None)

### **Improvements**

1. Updated HTTPS mechanism to address the CVE-2022-0778 (OpenSSL)
2. Wireless clients connected to different SSIDs on the same radio band could not communicate with each other

### **Known Issues**

(None)

---

Firmware Version	1.4.3 (Formal Release)
Release Type	<b>Regular</b> – Upgrade recommended when convenient
Release Date	02 <sup>nd</sup> December 2021
Build Date	08 <sup>th</sup> November 2021
Revision	g1094_6c65efb432
Applicable Models	VigorAP 960c
Locale	UK Only

### **New Features**

(None)

### **Improvements**

1. Improve the WebGUI security
2. [Wireless LAN] > [Station List] and [Dashboard] could not correctly display statistics for throughput or number of clients connected

### **Known Issues**

(None)

---

Firmware Version	1.4.2 (Formal Release)
Release Type	<b>Regular</b> – Upgrade recommended when convenient
Release Date	11 <sup>th</sup> August 2021
Build Date	29 <sup>th</sup> June 2021
Revision	g608_37e534907b
Applicable Models	VigorAP 960c
Locale	UK Only

### **New Features**

(None)

### **Improvements**

1. Updated wireless chipset drivers to resolve CVE-2020-26139 to CVE-2020-26145, CVE-2020-24586 to CVE-2020-24588

### **Known Issues**

(None)

---

Firmware Version	1.4.0 (Formal Release)
Release Type	<b>Regular</b> – Upgrade recommended when convenient
Release Date	16 <sup>th</sup> April 2021
Build Date	03 <sup>rd</sup> February 2021
Revision	g470_81a80a4fd8
Applicable Models	VigorAP 960c
Locale	UK Only

### **New Features**

(None)

### **Improvements**

1. Updated MyVigor authentication method
2. Updated the MAC OUI database
3. Fixed the configuration backup mechanism

### **Known Issues**

(None)

---

Firmware Version	1.3.9 (Formal Release)
Release Type	<b>Regular</b> – Upgrade recommended when convenient
Release Date	3 <sup>rd</sup> February 2021
Build Date	7 <sup>th</sup> December 2020
Revision	g346_5a3e053934
Applicable Models	VigorAP 960c
Locale	UK Only

### **New Features**

1. Added VigorAP Hotspot Web Portal
2. Added VigorAP Central Management

### **Improvements**

1. Improvements to Mesh transfer throughput
2. In some specific conditions, clients could not connect to 2.4GHz band with Roaming enabled
3. Corrected HTTP port number displayed in [External Devices] information

### **Known Issues**

(None)

---

Firmware Version	1.3.8 (Formal Release)
Release Type	<b>Initial Release</b>
Release Date	27 <sup>th</sup> August 2020
Build Date	27 <sup>th</sup> August 2020
Revision	12627
Applicable Models	VigorAP 960c
Locale	UK Only

**First Firmware Release for this model**

**Known Issues**

(None)

**[END OF FILE]**