

Release Notes for DrayTek VigorAP 960c (UK/Ireland)

| | |
|-------------------|--|
| Firmware Version | 1.4.10 (Formal Release) |
| Release Type | Regular – Upgrade recommended when convenient |
| Release Date | 4 th October 2024 |
| Build Date | 1 st August 2024 |
| Revision | g1719_3fb086fe63 |
| Applicable Models | VigorAP 960c |
| Locale | UK Only |

New Features

(None)

Improvements

1. Wireless clients on tagged SSIDs could not obtain an IP address

Known Issues

(None)


Firmware File Types

The file name of the firmware controls which upgrade type is performed. If the file name is unchanged (e.g. xxxx.all) then the upgrade will just upgrade the firmware, whereas renaming the firmware to a .rst extension will wipe all settings back to factory defaults when upgrading the firmware.

Upgrade Instructions

It is recommended that you take a configuration backup prior to upgrading the firmware. This can be done from the AP's system maintenance menu.

To upgrade firmware, select '*firmware upgrade*' from the AP's system maintenance menu and select the correct file. The access point will perform the upgrade and automatically reboot once this completes.

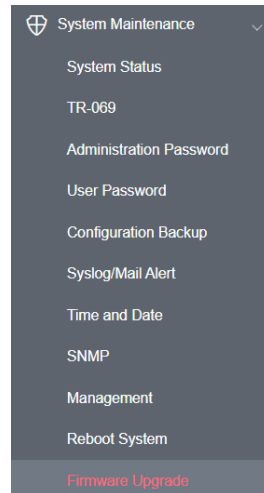

Manual Upgrade

If you cannot access the AP's menu, you can put the AP into 'TFTP' mode by holding the FACTORY RESET button whilst turning the unit on and then use the Firmware Utility. That will enable TFTP mode. TFTP mode is indicated by all LEDs flashing. This mode will also be automatically enabled by the router if there is a firmware/settings abnormality. Upgrading from the web interface is easier.

| | |
|-------------------|--|
| Firmware Version | 1.4.9 (Formal Release) |
| Release Type | Regular – Upgrade recommended when convenient |
| Release Date | 28th August 2024 |
| Build Date | 14 th June 2024 |
| Revision | g1715_c606078d61 |
| Applicable Models | VigorAP 960c |
| Locale | UK Only |

New Features

(None)

Improvements

1. Password mechanism changed to force admin to change the password from the default password
2. Client statistics could not be displayed via VigorACS
3. Some wireless clients would get other LAN's RA in SLAAC IPv6 environment
4. The Auto Channel Filtered Out List option on [Wireless LAN] > [Advanced Setting] failed to work

Known Issues

(None)

| | |
|-------------------|--|
| Firmware Version | 1.4.8 (Formal Release) |
| Release Type | Regular – Upgrade recommended when convenient |
| Release Date | 9 th January 2024 |
| Build Date | 1 st December 2023 |
| Revision | g1682_6b9d67b197 |
| Applicable Models | VigorAP 960c |
| Locale | UK Only |

New Features

(None)

Improvements

1. Improvements to the roaming features
2. Fix for the compatibility with VigorACS platform
3. VigorAP could not be accessed from the Internet
4. SSID did not broadcast when Fast Transition Roaming 802.11r was enabled

Known Issues

(None)

| | |
|-------------------|--|
| Firmware Version | 1.4.7 (Formal Release) |
| Release Type | Regular – Upgrade recommended when convenient |
| Release Date | 11 th April 2023 |
| Build Date | 23 rd February 2023 |
| Revision | g1568_f57251d5de |
| Applicable Models | VigorAP 960c |
| Locale | UK Only |

New Features

1. Event Alert feature added into [**Diagnostics**] > [**Alert Event**]
2. WLAN security supports WPA2 PPSK mode

Improvements

1. Improvements to the web GUI (CVE-2019-16645)
2. Web access via HTTPS didn't work well after the firmware upgrade

Known Issues

(None)

| | |
|-------------------|--|
| Firmware Version | 1.4.5 (Formal Release) |
| Release Type | Regular – Upgrade recommended when convenient |
| Release Date | 2 nd September 2022 |
| Build Date | 5 th August 2022 |
| Revision | g1460_09cc32292e |
| Applicable Models | VigorAP 960c |
| Locale | UK Only |

New Features

(None)

Improvements

1. Vigor router's Central AP Management could fail with VigorAP 960C access points after upgrading to 1.4.4 firmware

Known Issues

(None)

| | |
|-------------------|--|
| Firmware Version | 1.4.4 (Formal Release) |
| Release Type | Regular – Upgrade recommended when convenient |
| Release Date | 30 th June 2022 |
| Build Date | 06 th May 2022 |
| Revision | g1405_88af2ade15 |
| Applicable Models | VigorAP 960c |
| Locale | UK Only |

New Features

(None)

Improvements

1. Updated HTTPS mechanism to address the CVE-2022-0778 (OpenSSL)
2. Wireless clients connected to different SSIDs on the same radio band could not communicate with each other

Known Issues

(None)

| | |
|-------------------|--|
| Firmware Version | 1.4.3 (Formal Release) |
| Release Type | Regular – Upgrade recommended when convenient |
| Release Date | 02 nd December 2021 |
| Build Date | 08 th November 2021 |
| Revision | g1094_6c65efb432 |
| Applicable Models | VigorAP 960c |
| Locale | UK Only |

New Features

(None)

Improvements

1. Improve the WebGUI security
2. [Wireless LAN] > [Station List] and [Dashboard] could not correctly display statistics for throughput or number of clients connected

Known Issues

(None)

| | |
|-------------------|--|
| Firmware Version | 1.4.2 (Formal Release) |
| Release Type | Regular – Upgrade recommended when convenient |
| Release Date | 11 th August 2021 |
| Build Date | 29 th June 2021 |
| Revision | g608_37e534907b |
| Applicable Models | VigorAP 960c |
| Locale | UK Only |

New Features

(None)

Improvements

1. Updated wireless chipset drivers to resolve CVE-2020-26139 to CVE-2020-26145, CVE-2020-24586 to CVE-2020-24588

Known Issues

(None)

| | |
|-------------------|--|
| Firmware Version | 1.4.0 (Formal Release) |
| Release Type | Regular – Upgrade recommended when convenient |
| Release Date | 16 th April 2021 |
| Build Date | 03 rd February 2021 |
| Revision | g470_81a80a4fd8 |
| Applicable Models | VigorAP 960c |
| Locale | UK Only |

New Features

(None)

Improvements

1. Updated MyVigor authentication method
2. Updated the MAC OUI database
3. Fixed the configuration backup mechanism

Known Issues

(None)

| | |
|-------------------|--|
| Firmware Version | 1.3.9 (Formal Release) |
| Release Type | Regular – Upgrade recommended when convenient |
| Release Date | 3 rd February 2021 |
| Build Date | 7 th December 2020 |
| Revision | g346_5a3e053934 |
| Applicable Models | VigorAP 960c |
| Locale | UK Only |

New Features

1. Added VigorAP Hotspot Web Portal
2. Added VigorAP Central Management

Improvements

1. Improvements to Mesh transfer throughput
2. In some specific conditions, clients could not connect to 2.4GHz band with Roaming enabled
3. Corrected HTTP port number displayed in [External Devices] information

Known Issues

(None)

| | |
|-------------------|------------------------------|
| Firmware Version | 1.3.8 (Formal Release) |
| Release Type | Initial Release |
| Release Date | 27 th August 2020 |
| Build Date | 27 th August 2020 |
| Revision | 12627 |
| Applicable Models | VigorAP 960c |
| Locale | UK Only |

First Firmware Release for this model

Known Issues

(None)

[END OF FILE]